




SA series sensor bracket


Coding: 1600.A

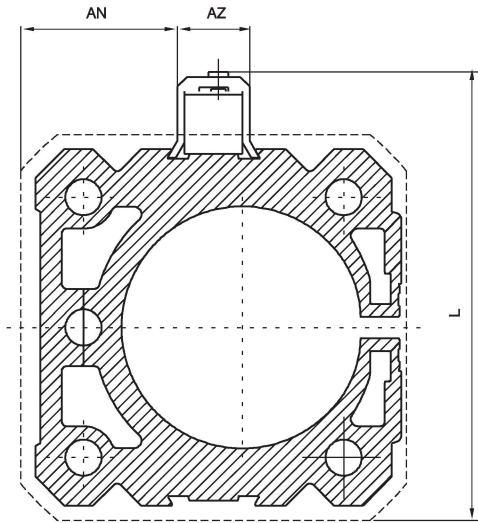

Bore		25	32	40	50	63
AN		12.5	20	25	32.5	40
AM		11	18	22	30	37.5
AZ		15				
AT		17.5				
L		55	68	79	94	110
LB		45	58	69	84	100
Weight (g)	1600.A	1				
	1600.C	2.5				

Bracket for sensor series SR - SU - SQ

Coding: 1600.C

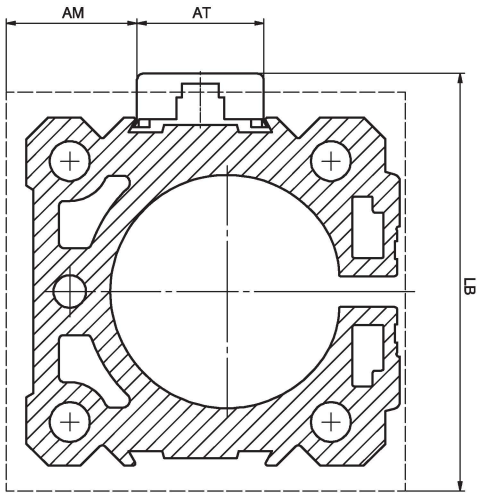

Sensors



for technical characteristics and ordering codes see magnetic sensors section



Foot

Coding: 1600.Ø.01F
(1 piece)



Bore Ø25, Ø32

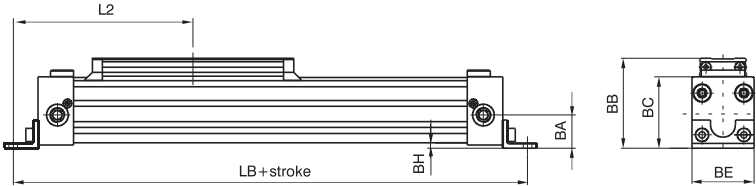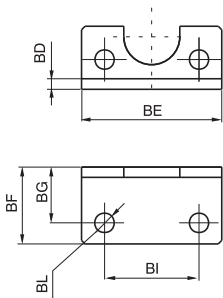

Bore Ø40, Ø50, Ø63



Bore	25	32	40	50	63
BA	21,5	28	32,5	41	49
BB	58	72,5	81,5	100	116
BC	46	57,5	66,5	82	97,5
BD	3	3	20	25	30
BE	40	55	65	80	95
BF	22	25	25	25	30
BG	16	18	12,5	12,5	15
BH	3,5	6	4,5	5	5
BI	27	36	30	40	48
BL	5,5	6,6	9	9	11
L2	116	143	162,5	187,5	230
LB	232	286	32,5	375	460
Weight (g)	30	45	65	110	190


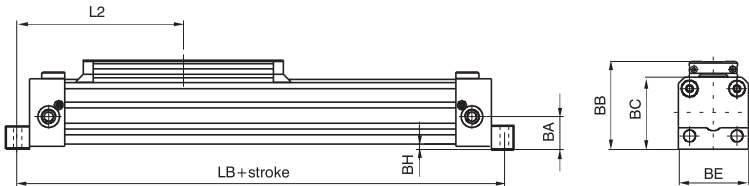
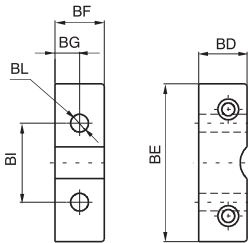







Intermediate support

Coding: 1600.Ø.02F

Bore Ø25, Ø32

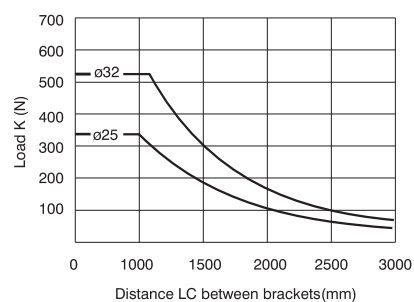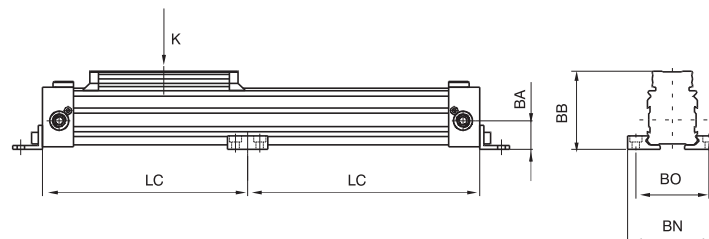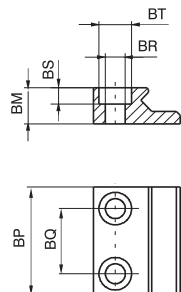

Bore Ø40, Ø50, Ø63

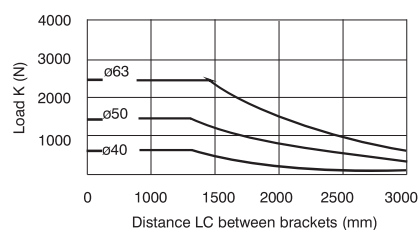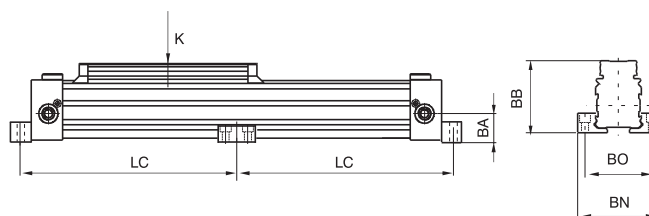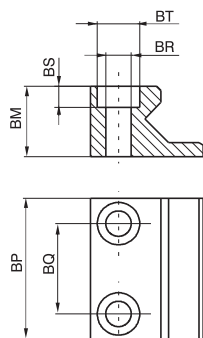



Bore	25	32	40	50	63
BA	21,5	28	32,5	41	49
BB	58	72,5	81,5	100	116
BM	10	18	18	25	30
BN	66	86	96	120	140
BO	54	70	80	100	120
BP	30	40	40	50	50
BQ	18	25	25	32	32
BR	5,5	6,6	6,6	9	9
BS	4,5	5,5	5,5	7,5	7,5
BT	9	11	11	15	15
Weight (g)	25	80	80	160	215



Oscillating hinge

Coding: 1600.Ø.03F

Bore Ø25, Ø32

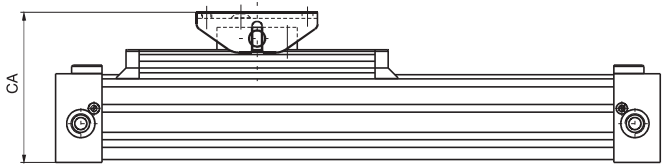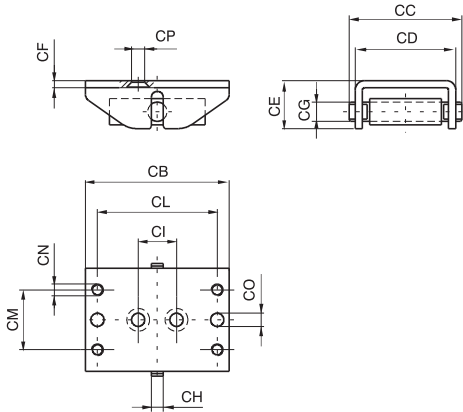

Bore Ø40, Ø50, Ø63



Bore	25	32	40	50	63
CA (±5,5)	76	99,5	108,5	135,5	151
CB	60	100	100	120	120
CC	47	64	64	92	92
CD (±5)	42	56	56	80	80
CE	20	30	30	42	42
CF	3	4	4	6	6
CG	8	12	2	16	16
CH	5	8	8	10	10
CI	16	40	40	65	65
CL	50	80	80	100	100
CM	25	30	30	47	47
CN	M5	M6	M6	M8	M8
CO	5,5	6,5	6,5	9	9
CP	5,5	7	7	-	-
Weight (g)	130	380	380	990	990

